EDGE LIGHTING

FJC-2SQ-
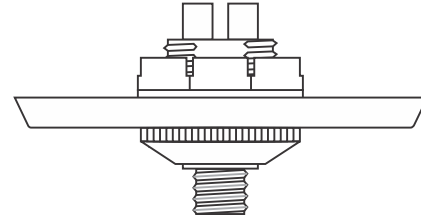**FJC-2RD-**

ETL LISTED c US
Intertek

Installation Instructions for 2" Round & Square Fast Jack For Remote Transformer
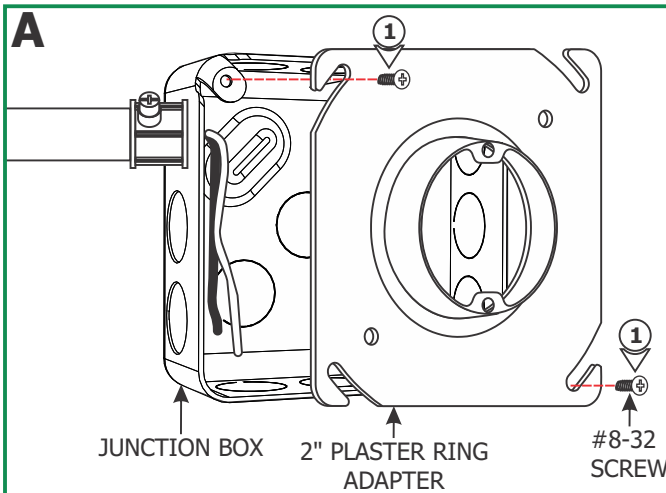
IMPORTANT INFORMATION
- This product is ETL listed for indoor dry locations.
- This product mounts to a 4" standard electrical box or octagon electrical box using the 2" plaster ring provided.
- A remote transformer should be installed prior to beginning this installation.
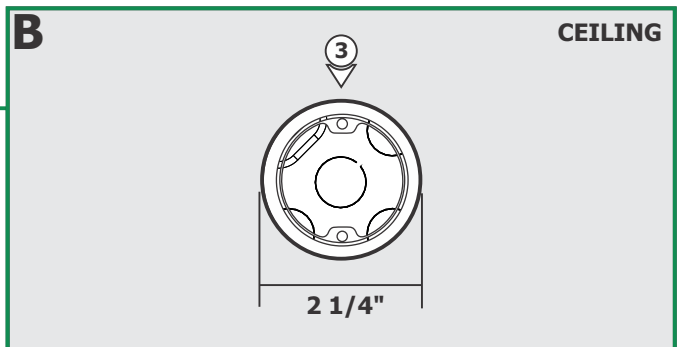
SAVE THESE INSTRUCTIONS!
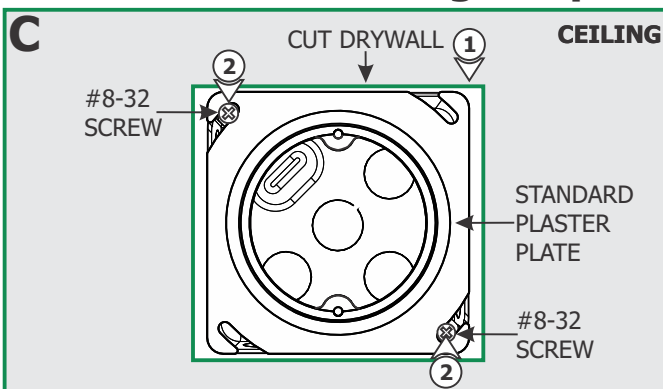
Install 2" Plaster Ring Adapter (New Construction)

A

JUNCTION BOX   2" PLASTER RING ADAPTER   #8-32 SCREW

NOTE: Junction box must be mounted to allow clearance of ½" between the face of the junction box and the drywall surface.

1: Install the 2" Plaster Ring Adapter to the junction box using two #8-32 screws.

2: Use a circular saw to cut out the drywall section where the junction box opening is.

3: Install the drywall. If necessary, plaster and finish the drywall.

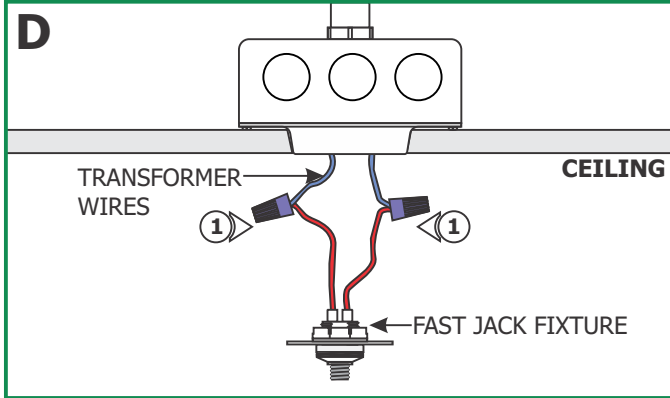**4:** Complete installation per "Install Fast Jack Port" section on Page 2.

B   **CEILING**

2 1/4"

Install 2" Plaster Ring Adapter (Remodel)

C   CUT DRYWALL   **CEILING**

#8-32 SCREW

STANDARD PLASTER PLATE

#8-32 SCREW

1: Cut away the drywall where the junction box is located.

2: Remove the plaster ring by removing the #8-32 screws.

3: Install the 2" Plaster Ring to the junction box using two #8-32 screws.

4: Plaster and finish around the junction box opening.

5: Complete installation by following steps in "Install Fast Jack Port" section on Page 2.
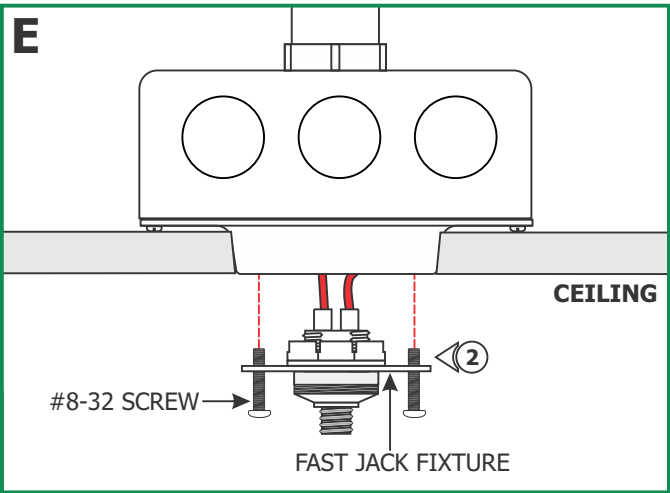
Install Fast Jack Port

D

TRANSFORMER WIRES
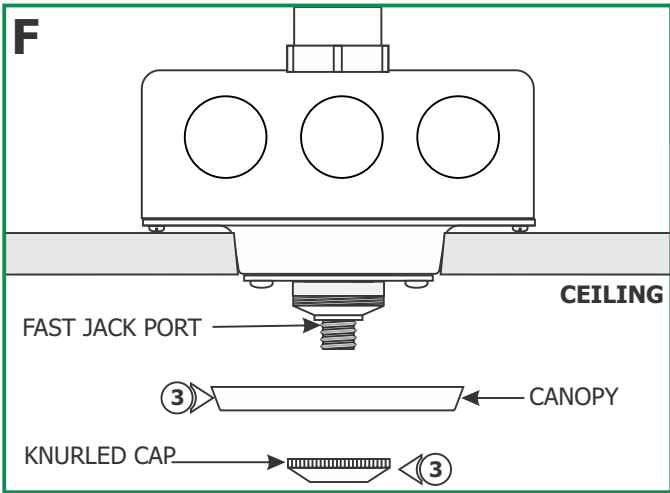
CEILING

① ①

FAST JACK FIXTURE

NOTE: Ensure that power supply wires from remote transformer are present in junction box before continuing.

1: Connect each remote transformer wire to one Fast Jack fixture wire with a wire nut.

E

CEILING

#8-32 SCREW →

②

FAST JACK FIXTURE

2: Place all wire and wire nut connections properly inside the junction box. Mount the Fast Jack port to the 2" Plaster Ring using two #8-32 screws provided.

3: Place the canopy onto the Fast Jack port against drywall and secure it in place by tightening the knurled cap to the Fast Jack port. **Make sure the knurled cap is not cross**

F

CEILING

FAST JACK PORT

③ CANOPY

KNURLED CAP ③

G

CEILING

FAST JACK PORT

FAST JACK FIXTURE CONNECTOR

④

4: Use fingers to tighten the Fast Jack fixture connector into the Fast Jack port.

2